

January 2015

Motorcycle Service Bulletin – SBMCAP1501

SUBJECT: NBC110 Steering Stem Inspection


Dear Australia Post Fleet Assembler, Repairer, DC Manager & Related Staff,

It has come to our attention that an issue may arise concerning the integrity of the weld on the base of the steering stem on the NBC110 Australia Post units. At present this is an isolated case whereby the forks were able to drop away from the steering stem.

In the interest of rider safety it is advised that the front forks are checked for movement and the welded area, shown below, is visually checked for damage or cracking as part of the pre ride inspection.


If movement of the forks or cracking of the weld is detected the unit should not be ridden and the appropriate personnel are advised to organise the repair.

The following photos show the area of concern.

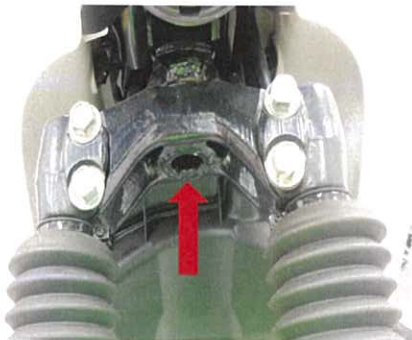

If you need further information regarding this *Motorcycle Service Bulletin* please contact the Honda Motorcycle Service Department on **03 9270 1108**.

Regards,

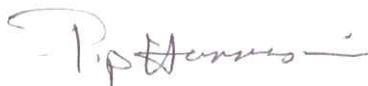

Pip Harrison

Technical Services Manager – Motorcycle Service

NOTE: Do not dispose of this bulletin, please file for future reference.